When you use the parts for a clockwise and anticlockwise rotation as a pair, it is easy to clamp a screw.

601

to fix vertical shaft

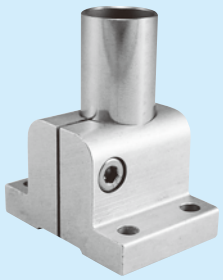

PH613,614

PR614
PT614
PU614

The type 601,614 is different shape.

Vertical hole

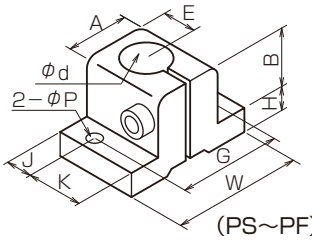

(PS~PF)

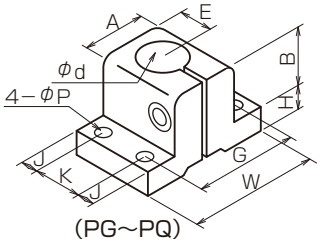

(PG~PQ)

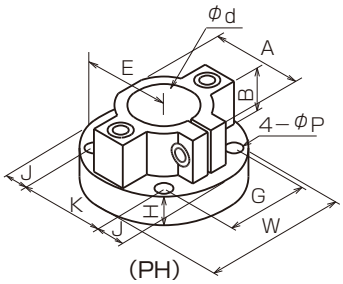

(PH)

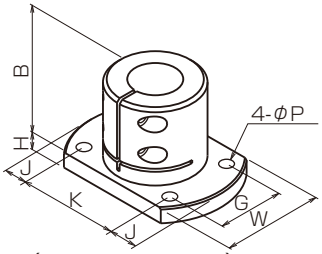

(PR614~PU614)

*Please note that the tightening direction of screws is different.

from left	from right	φd	H	B	E	A	W	G	J	K	φP	Cap screw
PS601	PS602	φ 6	5	10	5	12	26	20	5	9	2-φ3.3	M3
PE601	–	φ 8	6	13	7	16	32	24	7	11	2-φ4.2	M4
PC601	PC602	φ 9										
PF601	–	φ10			8				8	12		
PG601	–	φ12	7	17	9	20	38	30	5	14	4-φ4.2	
PJ601	PJ602	φ13			10							
PK601	–	φ15	9	22	12	26	48	38	6	18	4-φ5.2	M5
PN601	–	φ16			12							
PL601	PL602	φ19.1			14					21		
PQ601	–	φ20	10	25	14	30	52	42	6	23		
PH613	PH614	φ25.1	12	18	29	38	φ58	34	12	34	4-φ6.5	
PR614	–	φ30	10	50	–	–	–	43	16.5	65	4-φ8.5	2-M6
PT614	–	φ32			–	–	–					
PU614	–	φ35		55	–	–	–					2-M8

603

for lateral side or vertical shaft attachment

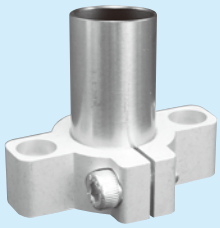

Flange

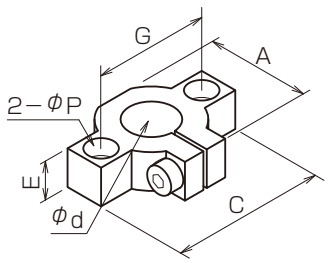

	φd	E	A	C	G	2-φP	Cap screw
PS603	φ 6	8	17	26	20	φ3.3	M3
PE603	φ 8	10	20	34	24	φ4.2	M4
PC603	φ 9						
PF603	φ10						
PG603	φ12		27	40	30		
PJ603	φ13						
PK603	φ15	12	31	50	38	φ5.5	M5
PN603	φ16						
PL603	φ19.1	14	31	50	38	φ5.2	
PQ603	φ20	16	38	54	42	φ5.5	
PH603	φ25.1	18					

608

for L-shape attachment and horizontal hole / stuck at the bottom

Vertical-horizontal hole

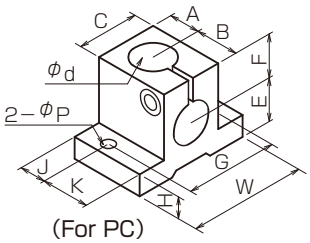

(For PC)

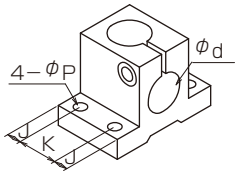

(For PJ,PL)

*Please note that the tightening direction of screws is different.

from left	from right	φd	E	F	A	B	C	H	G	W	J	K	φP	Cap screw
PC608	PC609	φ 9	11	11	7	11	16	6	24	32	7	11	2-φ4.2	M4
PJ608	PJ609	φ13	14	14	10	14	20	7	30	38	5	14	4-φ4.2	
PL608	PL609	φ19.1	18	18	14	19	26	9	38	48	6	21	4-φ5.2	M5